
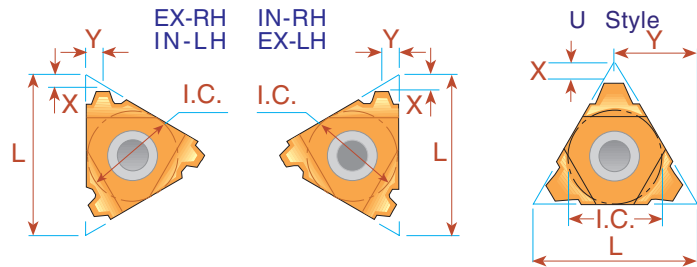


Acme

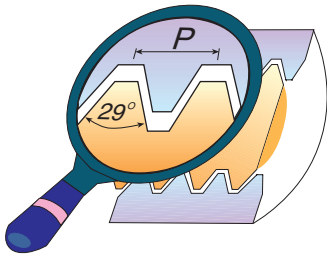

Pitch TPI	L	I.C. in	EXTERNAL Ordering Code		INTERNAL Ordering Code		X	Y
			Right Hand	Left Hand	Right Hand	Left Hand		
16	8	3/16	MINIATURE →		**08 IR 16 ACME	**08 IL 16 ACME	0.6	0.6
14	8U	3/16U	"U" MINIATURE →		*08U IR/L 14 ACME		0.8	4.0
12	8U	3/16U			*08U IR/L 12 ACME		0.8	4.0
10	8U	3/16U			*08U IR/L 10 ACME		0.8	4.0
16	11	1/4	11 ER 16 ACME	11 EL 16 ACME	11 IR 16 ACME	11 IL 16 ACME	0.9	1.0
16	16	3/8	16 ER 16 ACME	16 EL 16 ACME	16 IR 16 ACME	16 IL 16 ACME	0.9	1.0
14	16	3/8	16 ER 14 ACME	16 EL 14 ACME	16 IR 14 ACME	16 IL 14 ACME	1.0	1.2
12	16	3/8	16 ER 12 ACME	16 EL 12 ACME	16 IR 12 ACME	16 IL 12 ACME	1.1	1.2
10	16	3/8	16 ER 10 ACME	16 EL 10 ACME	16 IR 10 ACME	16 IL 10 ACME	1.3	1.3
8	16	3/8	16 ER 8 ACME	16 EL 8 ACME	16 IR 8 ACME	16 IL 8 ACME	1.5	1.5
6	16	3/8	16 ER 6 ACME	16 EL 6 ACME	16 IR 6 ACME	16 IL 6 ACME	1.7	1.8
6	22	1/2	22 ER 6 ACME	22 EL 6 ACME	22 IR 6 ACME	22 IL 6 ACME	1.8	2.1
5	22	1/2	22 ER 5 ACME	22 EL 5 ACME	22 IR 5 ACME	22 IL 5 ACME	2.0	2.3
4	22U	1/2U	22U ER/L 4 ACME		22U IR/L 4 ACME		2.3	11.0
4	27	5/8	27 ER 4 ACME	27 EL 4 ACME	27 IR 4 ACME	27 IL 4 ACME	2.3	2.7
3	27U	5/8U	27U ER/L 3 ACME		27U IR/L 3 ACME		2.8	13.7
2	33U	3/4U	33U ER/L 2 ACME		33U IR/L 2 ACME		4.3	16.9

Order example: 16 ER 16 ACME MXC

* Available only in BXC grade

** One cutting edge

Carbide Grade Selection

Choose the C.P.T. grade specifically formulated for your application from the following list:

Uncoated Grades

P30*
(P20-P30) Carbide grade for carbon and cast steels, works well at medium to low cutting speeds.

K20*
(K10-K30) Carbide grade for non ferrous metals, aluminum and cast iron.

Coated Grades

P25C
(P15-P35) PVD TiN coated grade for treated and hard alloy steels (25 HRC & up) at medium to low cutting speeds.

MXC
(K10-K20)
(P10-P25) PVD TiN coated micrograin for free cutting untreated alloy steels (below 30 HRC), for stainless steels and cast iron.

BMA
(P20-P40)
(K20-K30) PVD TiAlN coated sub-micrograin grade for stainless steels and exotic materials at medium to high cutting speeds.

BXC**
(P30-P50)
(K25-K40) PVD TiN coated grade for low cutting speed. Works well with wide range of stainless steels.

Note: Due to our unique and specialized production techniques, C.P.T. coated inserts provide superior cutting performance and exceptionally long tool life.


Recommended cutting speed (m/min) for thread turning inserts

ISO Standard	Materials	Coated				Uncoated	
		P25C*	MXC	BMA	BXC**	P30*	K20*
P	Steel: Low & Medium Carbon Steels	80-160	90-160	100-180	20-100	70-120	
	High Carbon Steels	80-120	80-150	90-160	30-80	60-100	
	Alloy Steels, Treated Steels	50-100	80-120	90-120	40-90	50-80	
	Cast Steel	80-140	100-140	120-160	30-80	50-100	
M	Stainless steel: Cast steels Stainless austenitic and austenitic ferritic steel and cast steel		70-120	90-130	30-90	70-100	80-100
K	Cast iron: Grey cast iron, cast iron with spherical graphite, malleable cast iron		80-130	80-150	30-90		60-100
N	Nonferrous Metal: Aluminium and other nonferrous metals, copper alloys non metallic		300-600		20-200		120-200
S	Super-alloys and Titanium: Heat resistant special alloys based on iron, nickel and cobalt, titanium and titanium alloys		40-80	50-100	15-30		
H	Hard Materials: Hardened steel, hardened cast iron materials, chilled cast iron		20-40	30-50	15-30		

- Upon request
- For miniature and ultra miniature insert

Conversion of Cutting Speed to Rotational Speed

Conversion of a selected cutting speed to rotational speed is calculated by the following formula:



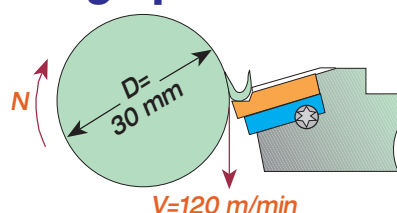


Example



$$N = \frac{V \times 1000}{\pi \times D} = \frac{120 \times 1000}{3.14 \times 30} = 1274 \text{ RPM}$$

Anvil Change Recommendation

As can be seen from the chart, some Pitch to Diameter combinations require an anvil change. If change is required, use AE anvils for EX-RH and IN-LH toolholders and AI anvils for IN-RH and EX-LH toolholders.

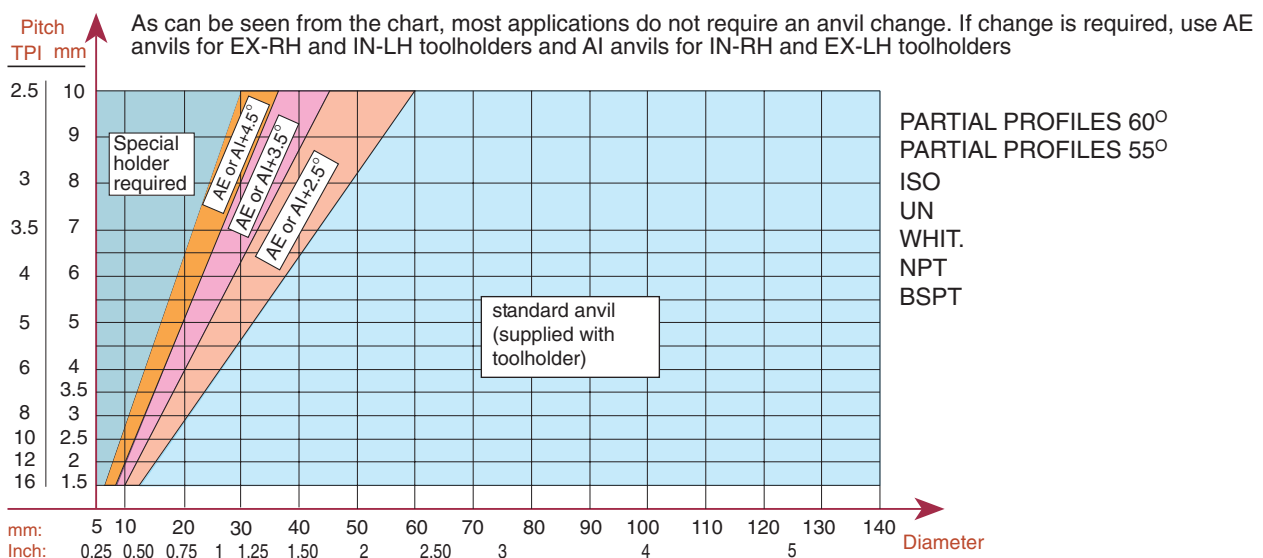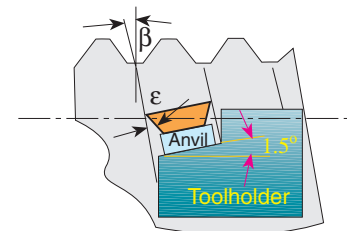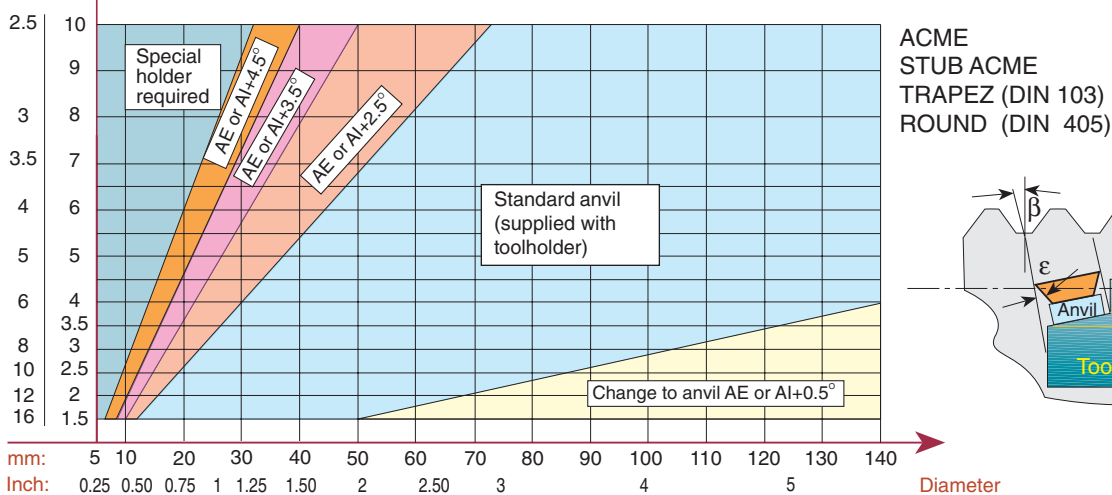


As can be seen from the chart, most applications require an anvil change. In most cases a negative anvil is required. use AE anvils for EX-RH

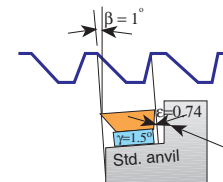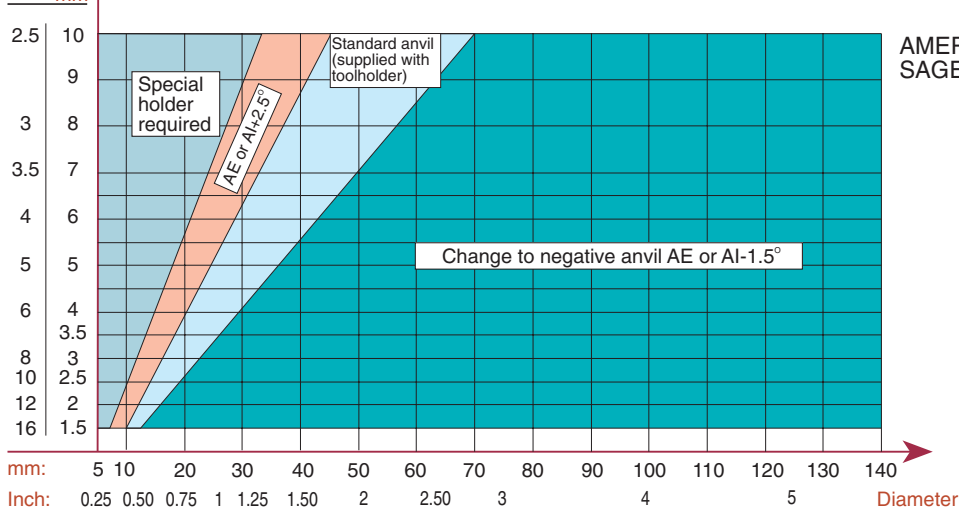

Before Anvil change

Replacing the standard anvil with an anvil with negative angle, will eliminate side rubbing

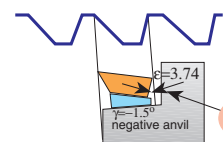

After Anvil Change