


CARBIDE, DREAM DRILLS MQL TYPE with COOLANT HOLES *EXTRA LONG*
VOLLHARTMETALL DREAM SPIRALBOHRER MQL - TYPE mit KÜHLKANAL in GERADZÄHLIGER SCHAFTAUSFÜHRUNG *ÜBERLANG*

► **Application** : Drilling steels in general, cast steels, cast iron, chilled cast iron, malleable cast iron, non-ferrous heavy metals, non-ferrous light metals, abrasive plastics.

► **Advantage** : Non step drilling up to 15 times (20 times) of drill diameter.
 Available for processing MQL (Minimum Quantity Lubrication).
 Excellent positioning
 - Bush is not necessary.
 Special design
 - Good chip removal
 Powerful drilling

► **Verwendung** : Zum wirtschaftlichen Bohren von Stahl allgemein, Stahlguß, Hart-und Temperguß, Nichteisen Leichtmetallen, abrasiven Kunststoffen.

► **Vorteile** : Bohren bis zu 15 x D (20 x D) ohne abzusetzen, Geeignet für MQL (minimale Kühlschmierung) Selbstzentrierend
 - Keine vorherige Zentrierung notwendig
 Kein Verlaufen
 - Keine Bohrbuchse notwendig
 Spezielle Bohrergerometrie
 - Gute Spanabfuhr
 Hochleistungsbohren

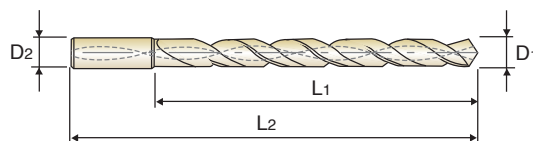
 15 × D
(DH515)

 20 × D
(DH520)

Unit : mm

EDP No.	Drill Diameter	Shank Diameter	Flute Length	Overall Length
TiAIN	D1	D2	L1	L2
DH515030	3.0	3	54	105
DH515035	3.5	4	63	114
DH515040	4.0	4	72	123
DH515045	4.5	5	81	134
DH515050	5.0	5	90	143
DH515055	5.5	6	99	154
DH515060	6.0	6	108	163
DH515070	7.0	7	126	182
DH515080	8.0	8	144	201
DH515090	9.0	9	162	220
DH515100	10.0	10	180	238
DH515110	11.0	11	198	262
DH515120	12.0	12	216	281

EDP No.	Drill Diameter	Shank Diameter	Flute Length	Overall Length
TiAIN	D1	D2	L1	L2
DH520030	3.0	3	69	120
DH520035	3.5	4	81	132
DH520040	4.0	4	92	143
DH520045	4.5	5	104	157
DH520050	5.0	5	115	168
DH520055	5.5	6	127	182
DH520060	6.0	6	138	193
DH520070	7.0	7	161	217
DH520080	8.0	8	184	241
DH520090	9.0	9	207	265
DH520100	10.0	10	230	288
DH520120	12.0	12	276	341

◎ : Excellent ○ : Good

Carbon Steels	Alloy Steels	Prehardened Steels	Hardened Steels		Cast Iron	Aluminum	Stainless Steels	Titanium	Mild Steels	Copper	Bronze	CFRP
~HB225	HB225~325	HRC30~45	HRC45~55	HRC55~								
◎	◎	○			○				○			



DREAM DRILLS -MQL TYPE

RECOMMENDED CUTTING CONDITIONS EMPFOHLENE SCHNEIDKONDITIONEN

**CARBIDE, DREAM DRILL MQL TYPE END MILL SHANK WITH COOLANT HOLE, TiAIN COATED
VOLLHARTMETALL DREAM BOHRER MQL-TYPE, TiAIN-BESCHICHTET**

DH510, DH515, DH520, DHM10, DHM15, DHM20 SERIES

WORK MATERIAL	CARBON STEELS ALLOY STEELS		CAST IRON		DUCTILE CAST IRON	
STRENGTH	~ 1060 N/mm ²		250 ~ 350 N/mm ²		400 ~ 500 N/mm ²	
DRILLING SPEED	63 ~ 125 m/min		63 ~ 125 m/min		60 ~ 80 m/min	
DIAMETER	N	S	N	S	N	S
3.0	7500	0.06~0.12	7500	0.06~0.12	7500	0.06~0.12
4.0	6400	0.08~0.16	6400	0.08~0.16	5600	0.08~0.16
5.0	5800	0.10~0.20	5800	0.10~0.20	4500	0.10~0.20
6.0	4800	0.12~0.24	4800	0.12~0.24	3800	0.12~0.24
8.0	3600	0.16~0.28	3600	0.16~0.28	2800	0.16~0.28
10.0	2900	0.20~0.35	2900	0.20~0.35	2300	0.20~0.35
12.0	2400	0.24~0.42	2400	0.24~0.42	1900	0.24~0.42
14.0	2050	0.28~0.46	2050	0.28~0.46	1600	0.28~0.46

N = R.P.M


S = Feed per Revolution (mm/rev.)

DHM25, DHM30 SERIES


WORK MATERIAL	CARBON STEELS ALLOY STEELS		CAST IRON		DUCTILE CAST IRON	
STRENGTH	~ 1060 N/mm ²		250 ~ 350 N/mm ²		400 ~ 500 N/mm ²	
DRILLING SPEED	50 ~ 110 m/min		50 ~ 110 m/min		40 ~ 70 m/min	
DIAMETER	N	S	N	S	N	S
3.0	6400	0.06~0.12	6400	0.06~0.12	6400	0.06~0.12
4.0	5500	0.08~0.16	5500	0.08~0.16	4700	0.08~0.16
5.0	4900	0.10~0.20	4900	0.10~0.20	3800	0.10~0.20
6.0	4200	0.12~0.24	4200	0.12~0.24	3200	0.12~0.24
8.0	3000	0.16~0.28	3000	0.16~0.28	2400	0.16~0.28
10.0	2500	0.20~0.35	2500	0.20~0.35	1900	0.20~0.35

N = R.P.M


S = Feed per Revolution (mm/rev.)




1. Guide Drilling should be done as Diameter+0.1mm between 3xD and 5xD depth.



2. For Main Drilling, proceed with low RPM at Guide Drilling segment.
(RPM 300, FEED 400mm/min)



3. Just before the end of Guide Drilling segment, reduce feed to zero and increase the RPM according to Recommended Cutting Condition chart (See above).



4. After then, proceed main drilling by increasing feed without step drilling.
5. When coming out from Guide Drilling start point after drilling, RPM should be reduced as 300 and feed should be 1000 mm/min.
6. When coming out from Guide Drilling segment to the outside, the feed should be decreased as 50%.