


i-Dream Drills

YA1A / YA2C

YB1A / YB2C

i-DREAM DRILL INSERTS & HOLDERS

i-DREAM DRILL EINSÄTZE UND HALTER

- Features of *i-Dream Drill Inserts*- Merkmale des i-Dream Drill Einsätze

- Secure and accurate seating resulting in accurate repeatability and concentricity.
Der sichere und genaue Sitz der Platte garantiert genaue Wiederholbarkeit beim Einsatz und beim Rundlauf.

i-Dream Drill General / i-Dream Drill allgemeinen



- For most steels materials / In den meisten Stahlsorten

i-Dream Drill INOX / i-Dream Drill INOX

- For tough, ductile materials and stainless steels
Für zähe, verformbare Werkstoffe und rostfreie Stähle.
- Light, sharp cutting edge / Scharfe Schneidkante
- Soft cutting action / Weicher Schnitt
- Minimize cutting forces / Minimaler Schneidendruck
- Reduce built-up edge / Reduzierte Gratbildung

- Features of *i-Dream Drill Holders*- Merkmale des i-Dream Drill Halter-

- Special Alloy Steels maintain its hardness and toughness under high temperatures.
Speziell legierter Stahl, der seine Härte und Zähigkeit auch bei hohen Temperaturen behält.
- Innovative surface treatment improves wear resistance and reduces corrosion.
Innovative Oberflächenbehandlung, die die Verschleißfestigkeit erhöht und die Korrosion vermindert.
- High Performance flute design allows maximum chip evacuation and minimum interference.
Optimierte Nutenform für maximale Spanabfuhr.

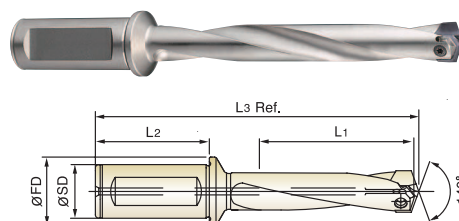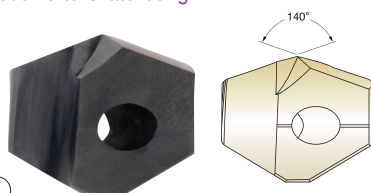

Series Range	Insert EDP No.		Insert O.D.			Holder EDP No.	Shank Dia.	Shank Length	Flange Dia.	Drilling Depth	Overall Length	Screw No.	
	General (TiAlN)	INOX (TiCN)	dec.	frac.	mm								
(mm)							SD	L2	FD	L1	L3 Ref.		
A Ø12.00 to Ø13.99	YA1A1200	YA2C1200	0.4724		12.00	ZH12003020	20	50	25	3D	36	112.4	TX1213T08
	YA1A1210	YA2C1210	0.4764		12.10	ZH12005020				5D	60	136.4	
	YA1A1220	YA2C1220	0.4803		12.20	ZH12007020				7D	84	160.4	
	YA1A1230	YA2C1230	0.4844	31/64	12.30								
	YA1A1250	YA2C1250	0.4921		12.50								
	YA1A1260	YA2C1260	0.4961		12.60	ZH12503020			3D	37.5	113.4		
	YA1A1270	YA2C1270	0.5000	1/2	12.70	ZH12505020	20	50	25	5D	62.5	138.4	TX1314T08
	YA1A1280	YA2C1280	0.5039		12.80	ZH12507020			7D	87.5	163.4		
	YA1A1290	YA2C1290	0.5079		12.90								
	YA1A1300	YA2C1300	0.5118		13.00	ZH13003020	20	50	25	3D	39	115.4	
	YA1A1310	YA2C1310	0.5156	33/64	13.10	ZH13005020				5D	65	141.4	
	YA1A1320	YA2C1320	0.5197		13.20	ZH13007020				7D	91	167.4	
	YA1A1349	YA2C1349	0.5312	17/32	13.49								
	YA1A1350	YA2C1350	0.5315		13.50								
	YA1A1360	YA2C1360	0.5354		13.60	ZH13503020			3D	40.5	116.4	TX1415T08	
	YA1A1370	YA2C1370	0.5394		13.70	ZH13505020	20	50	25	5D	67.5		143.4
	YA1A1380	YA2C1380	0.5433		13.80	ZH13507020			7D	94.5	170.4		
	YA1A1389	YA2C1389	0.5469	35/64	13.89								
YB1A1400	YB2C1400	0.5512		14.00									
YB1A1410	YB2C1410	0.5551		14.10	ZH14003020	20	50	25	3D	42	118.9		TX1415T08
YB1A1420	YB2C1420	0.5591		14.20	ZH14005020				5D	70	146.9		
YB1A1429	YB2C1429	0.5625	9/16	14.29	ZH14007020				7D	98	174.9		
YB1A1430	YB2C1430	0.5630		14.30									
YB1A1440	YB2C1440	0.5669		14.40									

► TiN, TiCN, TiAlN & Hardslick are available on your request.

► 10×D Holder is available on your request.

◎ : Excellent ○ : Good

	Non-alloy Steels, Free Machining Steels	Carbon Steels		Alloy Steels		High Alloyed steels		Structural Steels		Tool Steels		Stainless Steels	Cast Iron		Aluminum	Copper Alloys
	~HRC24 (~HB250)	~HRC28 (~HB275)	HRC28~ (HB275~)	~HRC28 (~HB275)	HRC28~ (HB275~)	~HRC37 (~HB350)	HRC37~ (HB350~)	~HRC24 (~HB250)	HRC24~ (HB250~)	~HRC13 (~HB200)	HRC13~ (HB200~)	~HRC28 (~HB275)	~HRC19 (~HB220)	HRC19~ (HB220~)	~HRC8 (~HB180)	~HB110
Y * 1A	◎	◎	◎	◎	◎	◎	◎	◎	◎	◎	◎		◎	◎		
Y * 2C	○	○		○				○		○		◎			○	○



METRIC

Material Werkstück		Tensile Strength	Hardness		Cutting Speed	Feed [mm/rev]				
		[N/mm²]	HB	HRC	Vc [M/min]	Ø12.0 ~Ø14.9	Ø15.0 ~Ø17.9	Ø18.0 ~Ø21.9	Ø22.0 ~Ø26.9	Ø27.0 ~Ø31.9
Non-alloyed steels, Cast steels Free-machining steels	9SMn28, 9SMnPb28,	~500	100~150		95~120	0.16~0.28	0.21~0.35	0.27~0.40	0.34~0.52	0.37~0.55
	10SPb20 etc	500~850	150~250	~24	80~105	0.14~0.24	0.21~0.35	0.27~0.40	0.34~0.52	0.37~0.55
Low-alloyed steels, Cast steels(<5%) Carbon steels	C15, C22, 20Mn5, Ck45, C45 etc	~450	85~125		90~115	0.14~0.25	0.20~0.33	0.25~0.39	0.31~0.47	0.34~0.50
		450~755	125~225	~19	70~90	0.12~0.20	0.17~0.28	0.22~0.32	0.30~0.46	0.33~0.49
		755~900	225~265	19~27	60~80	0.12~0.20	0.17~0.28	0.22~0.32	0.30~0.46	0.33~0.49
		900~1200	265~350	27~37	55~70	0.10~0.16	0.15~0.25	0.21~0.30	0.25~0.38	0.29~0.43
Alloyed steels	45CrMo4, 42CrMo4, 16MnCr5, Ck75, 35CrMo4, 16MnCr5 etc	~600	125~175	~7	80~100	0.14~0.24	0.17~0.28	0.22~0.32	0.30~0.46	0.34~0.50
		600~800	175~235	7~22	70~90	0.12~0.20	0.17~0.28	0.22~0.32	0.30~0.46	0.34~0.50
		800~950	235~280	22~29	60~80	0.12~0.20	0.15~0.25	0.22~0.32	0.30~0.46	0.34~0.50
		950~1110	280~330	29~35	55~70	0.10~0.16	0.13~0.21	0.21~0.30	0.25~0.38	0.29~0.43
		1110~1230	330~360	35~39	45~60	0.08~0.12	0.13~0.21	0.21~0.30	0.25~0.38	0.29~0.43
High-alloyed steels	36CrNiMo4, 41CrAlMo7 etc	600~1020	225~300	19~32	45~60	0.12~0.20	0.15~0.25	0.21~0.30	0.20~0.31	0.24~0.35
		1020~1200	300~355	32~38	40~55	0.10~0.16	0.11~0.18	0.21~0.30	0.20~0.31	0.24~0.35
		1200~1330	355~390	38~42	40~50	0.08~0.12	0.09~0.14	0.18~0.26	0.19~0.29	0.23~0.34
Structural steels	St33, St37-2, St44-2, St52, St60 etc	350~500	100~150		75~95	0.14~0.24	0.21~0.35	0.27~0.39	0.29~0.44	0.32~0.47
		500~850	150~250	~24	60~75	0.12~0.20	0.20~0.33	0.22~0.32	0.25~0.38	0.29~0.43
Tool steels	102Cr6, 105WCr6, C75W etc	850~1200	250~355	24~38	50~65	0.10~0.16	0.17~0.28	0.21~0.30	0.21~0.32	0.26~0.38
		500~705	150~210	~16	50~65	0.10~0.16	0.13~0.21	0.18~0.26	0.20~0.31	0.24~0.35
Grey cast iron	Pearlitic, Ferritic Pearlitic	705~950	210~280	16~29	40~50	0.10~0.16	0.13~0.21	0.18~0.26	0.20~0.31	0.24~0.35
		500~700	150~210	~16	100~125	0.15~0.26	0.20~0.37	0.27~0.42	0.36~0.51	0.40~0.55
Cast iron nodular	Ferritic Pearlitic	700~850	210~250	16~24	75~95	0.11~0.20	0.16~0.29	0.20~0.30	0.25~0.35	0.29~0.40
		540	165	4	95~120	0.13~0.22	0.17~0.31	0.21~0.32	0.28~0.40	0.32~0.44
Malleable cast iron	Ferritic Pearlitic	850	250	24	75~95	0.11~0.20	0.14~0.26	0.19~0.29	0.25~0.35	0.29~0.40
		450	125		100~125	0.13~0.22	0.17~0.31	0.21~0.32	0.28~0.40	0.32~0.44
Aluminum alloys (Wrought)	not heat treatable hardened	780	230	21	75~95	0.11~0.18	0.14~0.26	0.19~0.29	0.25~0.35	0.29~0.40
			65		250~330	0.30~0.40	0.35~0.45	0.40~0.50	0.45~0.55	0.50~0.60
Aluminum alloys (Cast)	≤12% Si, not heat treatable ≤12% Si, hardened >12% Si, not heat treatable Free machining(Pb>1%)		150		200~250	0.30~0.40	0.35~0.45	0.40~0.50	0.45~0.55	0.50~0.60
			75		200~50	0.25~0.35	0.30~0.40	0.35~0.45	0.40~0.50	0.45~0.55
			90		150~220	0.25~0.35	0.30~0.40	0.35~0.45	0.40~0.50	0.45~0.55
			130		100~200	0.20~0.30	0.25~0.35	0.30~0.40	0.35~0.45	0.40~0.50
Copper alloys	Brass Electrolitic copper		110		115~145	0.16~0.28	0.23~0.36	0.29~0.36	0.37~0.45	0.41~0.48
			90		145~185	0.17~0.29	0.24~0.37	0.30~0.38	0.38~0.46	0.42~0.49
Non ferrous material	Duroplastics Fiber plastics Hard rubber		100		95~120	0.06~0.09	0.09~0.13	0.11~0.13	0.15~0.18	0.19~0.22
Stainless steels	Austenitic and Austenitic/ferritic	450~610	135~185	~9	45~60	0.10~0.16	0.12~0.18	0.14~0.20	0.15~0.26	0.18~0.28
		610~930	185~275	9~28	30~45	0.08~0.14	0.09~0.15	0.10~0.16	0.12~0.20	0.14~0.22

*Formulas :

RPM = revolution per minute (rev/min)
M/min = surface meter per minute(M/min)
DIA. = diameter of drill (mm)
mm/rev = feed rate(mm/rev)

$$\begin{aligned} \text{M/min} &= \frac{(\text{RPM}) \cdot \pi \cdot (\text{DIA.})}{1000} \\ \text{mm/min} &= (\text{RPM}) \cdot (\text{mm/rev}) \\ \text{RPM} &= \frac{(\text{M/min}) \cdot 1000}{(\pi) \cdot (\text{DIA.})} \end{aligned}$$

- The recommendations for speeds, feeds and other parameters presented in this chart are nominal recommendations and should be considered only as good starting points.
Speed and feed reductions (20% reduction in speed and 10% reduction in feed) are recommended.
- Recommend you to reduce the feed rate to 85%,70% when you use 5xD,7xD holders.
- For use of 7xD holder, we recommend to drill a centering pre-hole with equal to or larger than 140 ° point angle to min. 2/3 cutting diameter.
The use of the centering pre-hole improves hole location , roundness and surface finish.



INCH

Material Werkstück		Tensile Strength	Hardness		Cutting Speed	Feed [IPR]				
		MPa	HB	HRC	Vc [SFM]	Ø31/64 ~Ø37/64	Ø19/32 ~Ø45/64	Ø23/32 ~Ø55/64	Ø7/8 ~Ø1-1/16	Ø1-3/32 ~Ø1-1/4
Non-alloyed steels, Cast steels Free-machining steels	9SMn28, 9SMnPb28, 10SPb20 etc	~500	100~150		312~394	0.006~0.011	0.008~0.014	0.011~0.016	0.013~0.020	0.015~0.022
		500~850	150~250	~24	262~344	0.006~0.009	0.008~0.014	0.011~0.016	0.013~0.020	0.015~0.022
Low-alloyed steels, Cast steels(<5%) Carbon steels	C15, C22, 20Mn5, Ck45, C45 etc	~450	85~125		295~377	0.006~0.010	0.008~0.013	0.010~0.015	0.012~0.019	0.013~0.020
		450~755	125~225	~19	230~295	0.005~0.008	0.007~0.011	0.009~0.013	0.012~0.018	0.013~0.019
		755~900	225~265	19~27	197~262	0.005~0.008	0.007~0.011	0.009~0.013	0.012~0.018	0.013~0.019
		900~1200	265~350	27~37	180~230	0.004~0.006	0.006~0.010	0.008~0.012	0.010~0.015	0.011~0.017
Alloyed steels	45CrMo4, 42CrMo4, 16MnCr5, Ck75, 35CrMo4, 16MnCr5 etc	~600	125~175	~7	262~328	0.006~0.009	0.007~0.011	0.009~0.013	0.012~0.018	0.013~0.020
		600~800	175~235	7~22	230~295	0.005~0.008	0.007~0.011	0.009~0.013	0.012~0.018	0.013~0.020
		800~950	235~280	22~29	197~262	0.005~0.008	0.006~0.010	0.009~0.013	0.012~0.018	0.013~0.020
		950~1110	280~330	29~35	180~230	0.004~0.006	0.005~0.008	0.008~0.012	0.010~0.015	0.011~0.017
		1110~1230	330~360	35~39	148~197	0.003~0.005	0.005~0.008	0.008~0.012	0.010~0.015	0.011~0.017
High-alloyed steels	36CrNiMo4, 41CrAlMo7 etc	600~1020	225~300	19~32	148~197	0.005~0.008	0.006~0.010	0.008~0.012	0.008~0.012	0.009~0.014
		1020~1200	300~355	32~38	131~180	0.004~0.006	0.004~0.007	0.008~0.012	0.008~0.012	0.009~0.014
		1200~1330	355~390	38~42	131~164	0.003~0.005	0.004~0.006	0.007~0.010	0.007~0.011	0.009~0.013
		350~500	100~150		246~312	0.006~0.009	0.008~0.014	0.011~0.015	0.011~0.017	0.013~0.019
Structural steels	St33, St37-2, St44-2, St52, St60 etc	500~850	150~250	~24	197~246	0.005~0.008	0.008~0.013	0.009~0.013	0.010~0.015	0.011~0.017
		850~1200	250~355	24~38	164~213	0.004~0.006	0.007~0.011	0.008~0.012	0.008~0.013	0.010~0.015
Tool steels	102Cr6, 105WCr6, C75W etc	500~705	150~210	~16	164~213	0.004~0.006	0.005~0.008	0.007~0.010	0.008~0.012	0.009~0.014
		705~950	210~280	16~29	131~164	0.004~0.006	0.005~0.008	0.007~0.010	0.008~0.012	0.009~0.014
Grey cast iron	Pearlitic, Ferritic Pearlitic	500~700	150~210	~16	328~410	0.006~0.010	0.008~0.015	0.011~0.017	0.014~0.020	0.016~0.022
		700~850	210~250	16~24	246~312	0.004~0.008	0.006~0.011	0.008~0.012	0.010~0.014	0.011~0.016
Cast iron nodular	Ferritic Pearlitic	540	165	4	312~394	0.005~0.009	0.007~0.012	0.008~0.013	0.011~0.016	0.013~0.017
		850	250	24	246~312	0.004~0.008	0.006~0.010	0.007~0.011	0.010~0.014	0.011~0.016
Malleable cast iron	Ferritic Pearlitic	450	125		328~410	0.005~0.009	0.007~0.012	0.008~0.013	0.011~0.016	0.013~0.017
		780	230	21	246~312	0.004~0.007	0.006~0.010	0.007~0.011	0.010~0.014	0.011~0.016
Aluminum alloys (Wrought)	not heat treatable hardened		65		820~1083	0.0118~0.0157	0.0138~0.0177	0.0157~0.0197	0.0177~0.0217	0.0197~0.0236
			150		656~820	0.0118~0.0157	0.0138~0.0177	0.0157~0.0197	0.0177~0.0217	0.0197~0.0236
Aluminum alloys (Cast)	≤12% Si, not heat treatable ≤12% Si, hardened >12% Si, not heat treatable		75		656~820	0.0098~0.0138	0.0118~0.0157	0.0138~0.0177	0.0157~0.0197	0.0177~0.0217
			90		492~722	0.0098~0.0138	0.0118~0.0157	0.0138~0.0177	0.0157~0.0197	0.0177~0.0217
			130		328~656	0.0079~0.0118	0.0098~0.0138	0.0118~0.0157	0.0138~0.0177	0.0157~0.0197
Copper alloys	Free machining(Pb>1%) Brass Electrolitic copper		110		377~476	0.006~0.011	0.009~0.014	0.011~0.014	0.015~0.018	0.016~0.019
			90		476~607	0.007~0.011	0.009~0.015	0.012~0.015	0.015~0.018	0.017~0.019
			100		312~394	0.002~0.004	0.004~0.005	0.004~0.005	0.006~0.007	0.007~0.009
Non ferrous material	Duroplastics Fiber plastics Hard rubber									
Stainless steels	Austenitic and Austenitic/ferritic	450~610	135~185	~9	145~197	0.004~0.006	0.005~0.007	0.006~0.008	0.006~0.011	0.007~0.011
		610~930	185~275	9~28	89~145	0.003~0.005	0.004~0.006	0.004~0.006	0.005~0.008	0.006~0.009

*Formulas :

RPM = revolution per minute (rev/min)
SFM = surface feet per minute (ft/min)
DIA. = diameter of drill (inch)
IPR = feed rate (inch/rev)
IPM = inch per minute penetration rate

$$\begin{aligned} \text{SFM} &= \frac{(\text{RPM}) \cdot \pi \cdot (\text{DIA.})}{12} \\ \text{IPM} &= (\text{RPM}) \cdot (\text{IPR}) \\ \text{RPM} &= \frac{(\text{SFM}) \cdot 12}{(\pi) \cdot (\text{DIA.})} \end{aligned}$$

► The recommendations for speeds, feeds and other parameters presented in this chart are nominal recommendations and should be considered only as good starting points.

Speed and feed reductions (20% reduction in speed and 10% reduction in feed) are recommended.

► Recommend you to reduce the feed rate to 85%,70% when you use 5xD,7xD holders.

► For use of 7xD holder, we recommend to drill a centering pre-hole with equal to or larger than 140 ° point angle to min. 2/3 cutting diameter.

The use of the centering pre-hole improves hole location , roundness and surface finish.